Maryland Historical Trust

Maryland Inventory of Historic Properties number: BA-Z670 Name: POOP / WEISPEURG, ROOVERSECOND MINERER
The bridge referenced herein was inventoried by the Maryland State Highway Administration as part of the Historic Bridge Inventory, and SHA provided the Trust with eligibility determinations in February 2001. The Trust accepted the Historic Bridge Inventory on April 3, 2001. The bridge received the following determination of eligibility.
MARYLAND HISTORICAL TRUST
Eligibility Recommended Eligibility Not RecommendedX
Criteria:ABCD Considerations:ABCDEFGNone
Comments:

Reviewer, OPS:_Anne E. Bruder_

Reviewer, NR Program:__Peter E. Kurtze_

Date:__3 April 2001____

Date:__3 April 2001_

MARYLAND INVENTORY OF HISTORIC BRIDGES HISTORIC BRIDGE INVENTORY MARYLAND STATE HIGHWAY ADMINISTRATION/ MARYLAND HISTORICAL TRUST

SHA Bridge No. B 009	Bridge name Weisburg Road over Second Mine Branch				
LOCATION: Street/Road name and number [faci	ility carried] Weisburg Road				
City/town White Hall	Vicinity				
County Baltimore					
This bridge projects over: Road	Railway Water X Land				
Ownership: State C	ounty X Municipal Other				
National Register-listed district _	d historic district? Yes No _X rict National Register-determined-eligible district Other				
BRIDGE TYPE: Timber Bridge:	russ -Covered Trestle Timber-And-Concrete				
Movable Bridge: Swing Bascule Vertical Lift Retract	e Single Leaf Bascule Multiple Leaf tile Pontoon				
Rolled Girder	Rolled Girder Concrete Encased Plate Girder Concrete Encased				
Metal Suspension					
Metal Arch					
Metal Cantilever					
Concrete X: Concrete Arch Co	oncrete Slab_X Concrete Beam Rigid Frame				
Other Type Name					

DESCRIPTION: Setting: Urban Small town X Rural
Describe Setting:
Bridge B009 carries Wiesburg Road in a north-south direction over Second Mine Branch which flows in a westerly direction. The bridge is in the town of White Hall with three houses and two stores adjacent to the bridge; an old railroad bridge is approximately 100 feet downstream from the bridge.
Describe Superstructure and Substructure: Bridge B009 is a single span concrete slab on concrete abutments with concrete wingwalls. The span length is 28.0 feet and the overall length is 32.0 feet, curb to curb width is 28.0 feet and the deck out to out width is 31.3 feet; the skew is 29 degrees. The wingwalls flare at about 45 degrees to the centerline of the bridge.
Discuss Major Alterations: The superstructure was reconstructed in 1990, replacing the deck and the parapets.
HISTORY:
WHEN was bridge built (actual date or date range) 1926, 1990 (superstructure reconstructed)
This date is: Actual X Estimated Design plans County bridge files/inspection form X Other (specify)
WHY was the bridge built? The need for a more efficient transportation network and increased load capacity in the decades following World War I.
WHO was the designer? State Highway Administration
WHO was the builder? Unknown
WHY was the bridge altered? The bridge was reconstructed to address inadequate structure.
Was this bridge built as part of an organized bridge-building campaign? As part of an effort by the State to increase load capacity on secondary roads during the 1920s.
SURVEYOR/HISTORIAN ANALYSIS:
This bridge may have National Register significance for its association with: A - Events B- Person C- Engineering/architectural character
This bridge does not have National Register significance.

Was the bridge constructed in response to significant events in Maryland or local history?

Reinforced concrete slab bridges are a twentieth century structure type, easily adapted to the need for expedient engineering solutions. Reinforced concrete technology developed rapidly in the early twentieth century with early recognition of the potential for standardized design. The first U.S. attempt to standardize concrete design specifications came in 1903-04 with the formation of the Joint Committee on Concrete and Reinforced Concrete of the American Society of Civil Engineers.

Maryland's road and bridge improvement programs mirrored economic cycles. The first road improvement program of the State Roads Commission was a 7 year program, starting with the Commission's establishment in 1908 and ending in 1915. Due to World War I, the period from 1916-1920 was one of relative inactivity; only roads of first priority were built. Truck traffic resulting from war-related factories and military installations generated new, heavy traffic unanticipated by the builders of the early road system. From 1920 to 1929, numerous highway improvements occurred in response to the increase in Maryland motor vehicles from 103,000 in 1920 to 320,000 in 1929, with emphasis on the secondary system of feeder roads which moved traffic from the primary roads built before World War I. After World War I, Maryland's bridge system also was appraised as too narrow and structurally inadequate for the increasing traffic, with plans for an expanded bridge program to be handled by the Bridge Division, set up in 1920. In 1920 under Chapter 508 of the Acts of 1920 the State issued a bond of \$3,000,000.00 for road construction; the primary purpose of these monies was to meet the state obligations involving the construction of rural post roads. The secondary purpose of these monies was to fund [with an equal sum from the counties] the building of lateral roads. The number of hard surfaced roads on the state system grew from 2000 in 1920 to 3200 in 1930. By 1930, Maryland's primary system had become inadequate to the huge freight trucks and volume of passenger cars in use, with major improvements occurring in the late 1930s. Most improvements to local roads waited until the years after World War II.

With a diverse topographical domain encompassing numerous small and large crossings, Maryland engineers quickly recognized the need for expedient design and construction.

In the early years, there was a need to replace the numerous single lane timber bridges. Walter Wilson Crosby, Chief Engineer stated in 1906, "The general plan has been to replace these [wood bridges] with pipe culverts or concrete bridges and thus forever do way with the further expense of the maintenance of expensive and dangerous wooden structures". Within a few years, readily constructed standardized bridges of concrete were being built throughout the state.

The creation of standard plans and a description of their use was first announced in the 1912-15 <u>Reports of the State Roads Commission</u> whereby bridges spanning up to 36 feet were to use standardized designs.

Published on a single sheet, the 1912 Standard Plans included those structures that were amenable to such an approach: slab spans, (deck) girder spans, box culverts, box bridges, abutments, and piers (State Roads Commission 1912). Slab spans, with lengths of 6 to 16 feet in two foot increments, featured a solid parapet that was integrated into the slab, with a roadway of 22 feet.

In the Report for the years 1916-1919, a revision of the standard plans was noted:

During the four years covered by this report, it has been found necessary to revise our standard plans for culverts and bridges, to take care of the increased tonnage which they have been forced to carry. Army cantonments...increased their operations several hundred per cent, and the brunt of the enormous truck traffic resulting therefrom, was borne by the State Roads of Maryland. In addition

to these war activities, freight motor lines from Baltimore to Washington, Philadelphia, New York, and various points throughout Maryland, and the weight of many of these trucks when loaded, was in excess of the loads for which our early bridges were designed (State Roads Commission 1920:56).

Published on separate sheets, the new standard plans (State Roads Commission 1919) for slab bridges reveal that the major changes was an increase in roadway width from 22 feet to 24 feet and a redesign of the reinforcement. The slab spans continued to feature solid parapets integrated into the span. The range of span lengths remained 6 to 16 feet, but the next year (1920) witnessed the issue of a supplemental plan for a 20 foot long slab span (State Roads Commission 1920).

The 1924 standard plans remained in effect until 1930, when the roadway width for all standard plan bridges was increased to 27 feet in order to accommodate the increasing demands of automobile and truck traffic (State Roads Commission 1930). The range of span lengths remained the same, but there were some changes designed to increase load bearing capacities. The reinforcing bars were increased in thickness. Visually, the 1930 design can be distinguished from its predecessors by the pierced concrete railing that was introduced at this time.

Three years later, in 1933, a new set of standard plans was introduced (State Roads Commission 1933). This time, their preparation was not announced in the <u>Report</u>; new standard plans were by this time nothing special - they had indeed become standard. Once again accommodating the ever-increasing demands of traffic, the roadway width was increased, this time to 30 feet. The slab span's reinforcing bars remained the same diameter but were placed closer together to achieve still more load bearing capacity.

A system of standard nomenclature for plans was introduced at this time: span type was indicated by a two-letter designator followed by span length and the year of the plan. Thus, CS-18-33 indicates an 18 foot concrete slab of the 1933 standard plan design; CG-36-33 was a 36 foot concrete girder (T-beam) of the same year. The inclusion of the year designator gave ready access to design details for each bridge and indicates that the State Roads Commission anticipated revisions to standard plans.

Based upon documentary evidence, Baltimore County and City were the early pioneers in concrete bridge building in Maryland. The first reinforced concrete bridge documented in Maryland was the bridge at Sherwood Station, built in 1903 by Baltimore County.

Evidence from historic maps suggests that almost all of the extant concrete slab bridges built before 1940 in Baltimore County replaced earlier bridges. With the exception of two bridges, all of these structures lie on roads whose alignments have changed little since the middle of the nineteenth century. The two exceptions are both located on Shelbourne Avenue in Arbutus. Shelbourne Avenue does not appear on the 1850 map of Baltimore County but does appear on the 1915 map. Both concrete slabs bridges on Shelbourne Avenue, however, were built after 1915. The evidence therefore suggests that these two bridges were also built to replace previous structures.

When the bridge was built and/or given a major alteration, did it have a significant impact on the growth and development of the area?

There is no evidence to suggest that the construction of this bridge had a significant impact on the growth and development of this area.

_Name of surveyor _

Phone

add to or detract from the historic/visual character of the potential district? The bridge is not located in an area which may be eligible for historic designation.
Is the bridge a significant example of its type? The bridge is not a significant example of its type. The superstructure was replaced in 1990.
Does the bridge retain integrity of important elements described in Context Addendum? The character defining elements have not retained their integrity. The slab and parapets were replaced in 1990.
Is the bridge a significant example of the work of a manufacturer, designer, and/or engineer? This bridge is not a significant example of the work of a manufacturer, designer, and/or engineer.
Should the bridge be given further study before an evaluation of its significance is made? No further study of this bridge will be necessary to evaluate its significance.
BIBLIOGRAPHY:
County inspection/bridge files \underline{X} SHA inspection/bridge files \underline{X} Other (list):
SURVEYOR:

Organization/Address P.A.C. Spero & Company, Suite 412, 40 West Chesapeake Ave., Baltimore, MD


FAX number (410) 296-1670

Date bridge recorded _

number (410) 296-1635

21204

08/15/95

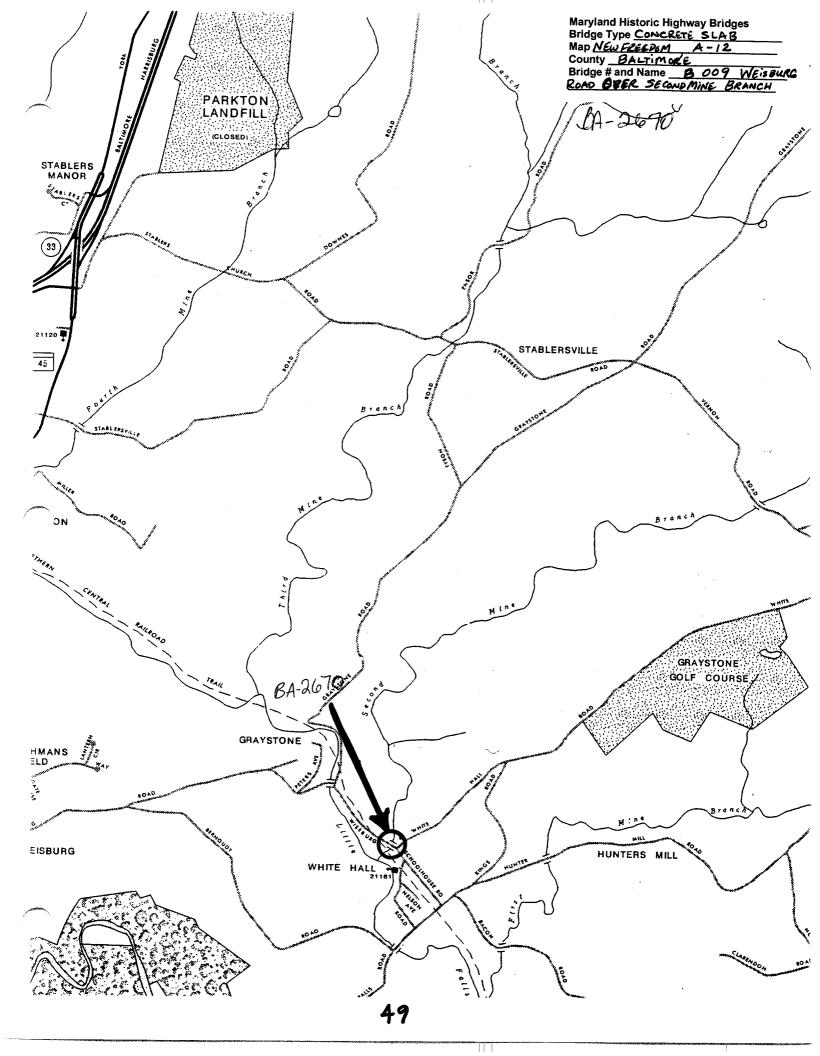



Inventory # <u>8A 2670</u>

Name 15009- WISEBURG, RO OVER SECOND MINE BRANC County/State BALTIMORE COUNTY/MO Name of Photographer DAVE DIENL	-
Date SHA Location of Negative SHA	
Description EAST APPROACH LOOKING WEST	
Number 4 of 365	



Inventory # BA 2670

	MAG NO OVER SECONDMINE BRAINDRE COUNTY MO TORVE GEHL	UCH
Location of Negative	SHA	
Description SOUTH	ELEVATION LOOKING N	SRTH
Number S of 36		



Inventory # <u>Ba</u> 2670

Name BOOG - WISEBURG RD WER SECOND MINE BRU County/State BALTIMORE COUNTY/MO Name of Photographer DANE DEHL Date 1/95	inci
Location of Negative SNA	
Description WATH ELEVATION LOOKING SOUTH	1
Statements temperature	
Number <u>6 of 25</u>	



Inventory #BA-2670

Name BUNG - WISEBURG RD OVER SECONDMINE BRANCI
County/State BAUTIMORE COUNTY/MO
Name of Photographer DAVE DIEHL
Date
999 1
Location of Negative SHA
Description WEST APPROACH LOUKING EAST
SETTING IN THE PRETACTION OF THE PROPERTY OF T
Number 7 of 365
Number of of



Inventory # <u>BA-2676</u>

Name Boug.	WISE	BURG RO	WER S	ECONO 1	AINE	BRANC
County/State	BAL	TIMURE	Cour	NIM	P	
Name of Pho	tograp	her DAVE	DIE	HL		
Date	95					
Location of l	Negativ	re Sith	7			
Description	010	RAILROA	o Br	LIDGE	160	FEBT
1	DUN	NSTREAM	FRON	n Bu	751	

Number 8 of 265